

Item description/product images



Description

**Material:**  
Polyamide.

**Version:**  
Ivory coloured.

**Note:**

Bubble levels are used as a type of zero indicator instrument for checking horizontal inclination in e.g. spirit levels, inclinometers, metrology instruments and machine constructions.

With internal black contrast ring for better bubble contour.


- Protruding fill point underneath.
- Sensitivity in angular minutes for 2 mm bubble travel
- Clear filling

**Temperature range:**

-35 °C up to +55 °C.

Angular minutes	Degrees in decimals	Height difference in millimetres per metre
1'	0.0167°	0.291 mm
5'	0.0833°	1.455 mm
10'	0.1667°	2.910 mm
20'	0.3333°	5.820 mm
25'	0.4167°	7.275 mm
30'	0.5000°	8.730 mm
40'	0.6667°	11.640 mm
50'	0.8333°	14.550 mm
53'	0.8833°	15.423 mm

Drawings

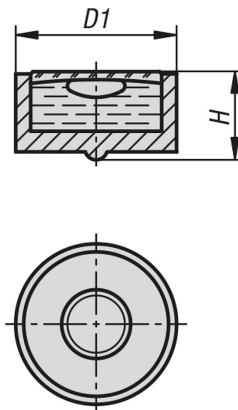

Overview of items

Order No.	D1	H	Sensitivity
21810-120720	12	7	20'
21810-140730	14	7,7	30'
21810-150720	15	7,7	20'
21810-180930	18	9,2	30'
21810-201040	20	10,6	40'
21810-251230	25	11,5	30'